




## Flange Tables JIS B 2238

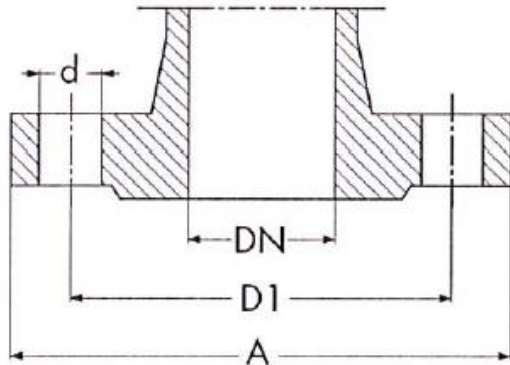

A = flange  $\varnothing$   
D1 = pitch circle  $\varnothing$   
n = number of bolt holes  
d = bolt hole  $\varnothing$

DN		5K	10K	16K	20K	30K	40K
10	A	75	90	90	90	110	110
	D1	55	65	65	65	75	75
	n x d	4 x 12	4 x 15	4 x 15	4 x 15	4 x 19	4 x 19
15	A	80	95	95	95	115	115
	D1	60	70	70	70	80	80
	n x d	4 x 12	4 x 15	4 x 15	4 x 15	4 x 19	4 x 19
20	A	85	100	100	100	120	120
	D1	65	75	75	75	85	85
	n x d	4 x 12	4 x 15	4 x 15	4 x 15	4 x 19	4 x 19
25	A	95	125	125	125	130	130
	D1	75	90	90	90	95	70
	n x d	4 x 12	4 x 19	4 x 19	4 x 19	4 x 19	4 x 19
32	A	115	135	135	135	140	140
	D1	90	100	100	100	105	105
	n x d	4 x 15	4 x 19	4 x 19	4 x 19	4 x 19	4 x 19
40	A	120	140	140	140	160	160
	D1	95	105	105	105	120	120
	n x d	4 x 15	4 x 19	4 x 19	4 x 19	4 x 23	4 x 23
50	A	130	155	155	155	155	165
	D1	105	120	120	120	120	130
	n x d	4 x 15	4 x 19	8 x 19	8 x 19	8 x 19	8 x 19
65	A	155	175	175	175	200	200
	D1	130	140	140	140	160	160
	n x d	4 x 15	4 x 19	8 x 19	8 x 19	8 x 23	8 x 23
80	A	180	185	200	200	210	210
	D1	145	150	160	160	170	170
	n x d	4 x 19	8 x 19	8 x 23	8 x 23	8 x 23	8 x 23
100	A	200	210	225	225	240	250
	D1	165	175	185	185	195	205
	n x d	8 x 19	8 x 19	8 x 23	8 x 23	8 x 25	8 x 25
125	A	235	250	270	270	275	300
	D1	200	210	225	225	230	250
	n x d	8 x 19	8 x 23	8 x 25	8 x 25	8 x 25	8 x 27
150	A	265	280	305	305	325	255
	D1	230	240	260	260	275	295
	n x d	8 x 19	8 x 23	12 x 25	12 x 25	12 x 27	12 x 33
200	A	320	330	350	350	370	405
	D1	280	290	305	305	320	345
	n x d	8 x 23	12 x 23	12 x 25	12 x 25	12 x 27	12 x 33
250	A	385	400	430	430	450	275
	D1	345	355	380	380	390	410
	n x d	12 x 23	12 x 25	12 x 27	12 x 27	12 x 33	12 x 33
300	A	430	445	480	480	515	540
	D1	390	400	430	430	450	470
	n x d	12 x 23	16 x 25	16 x 27	16 x 27	16 x 33	16 x 39